



21834 Avenue Rockefeller
 Phone: (818) 291-0338
 Email: Info@HyeTechLLC.com

Valencia, CA 91355
 Fax: (818) 291-0339
 Web: www.HyeTechLLC.com

IFCA-E-002

Inspection & Rework Procedure for Spanner Nuts.

For Warranty Policy & Model Eligibility, Please visit us at www.hyetechllc.com

Compliance: Any time a Spanner Nut is removed, refer to the following inspection & rework limits.

Notes: Refer to OEM’s published data for installation, engine operation and disassembly.

For inspection & rework for part numbers: 6808392HT
 6829641HT
 6840407HT
 6876878HT

NOTE: Spanner nut **6840406HT** is **NOT** repairable. After installation & staking, inspect for cracks. No cracks permitted. No repair permitted.

Condition	Service Limit	Repair Limit	Corrective Action
Cracks (FPI per latest revision to ASTM E1417)	After grinding previous staking damage, inspect all over. Pay close attention in the functional areas & locking skirts. No cracks are permissible.	Unused locking skirt insufficient for staking	Repair or replace. Grind out staking damage.